





GM 1.4L Oil Filter Product Alert

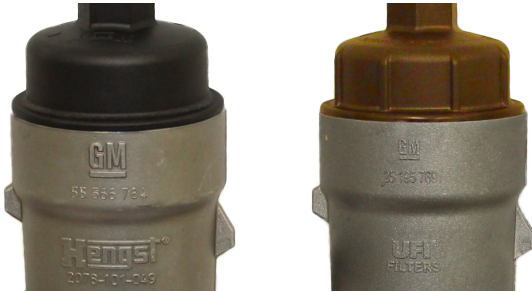

GM 1.4L engines may be equipped with either a HENGST® or an UFI® manufactured oil filter housing and cap. Each housing is unique and requires a specifically designed filter to function properly. **The filters for the differing oil housings are not interchangeable and if incorrectly used may lead to serious engine damage.**

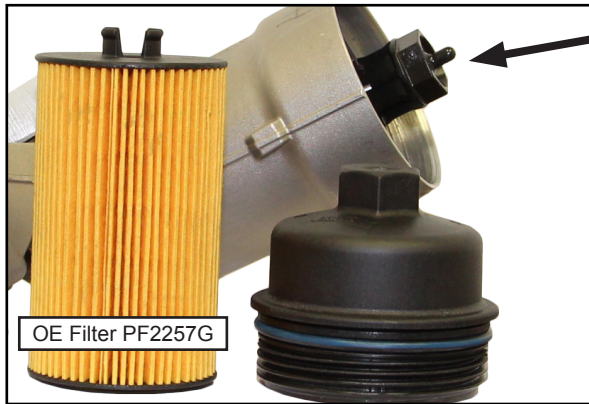


The HENGST® housing is equipped with a bypass valve located in the housing's post.

WIX Filters recommends the 57674 oil filter for the GM 1.4L Engine with the HENGST®



WARNING:
The 57674 cannot be used in the UFI® housing (Brown Cap).

The UFI® housing is not equipped with a bypass valve. The bypass valve is located in the oil filter.

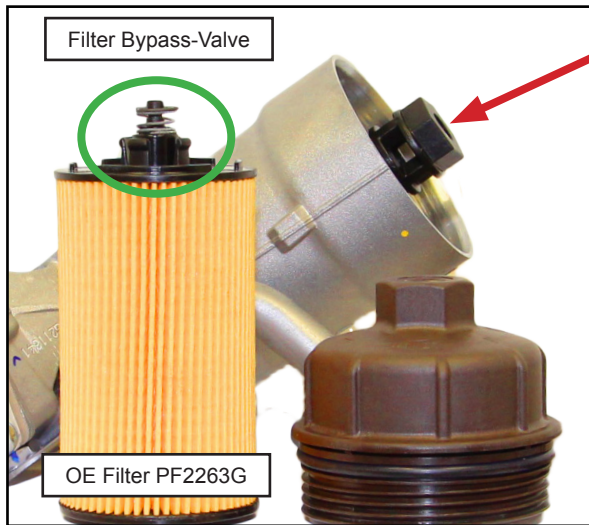

The WIX replacement filter for the GM 1.4L Engine with the UFI® housing is currently under development.



Replacement Filter Currently Under Development

WARNING:
The filter with the built-in bypass valve is not suitable for use in the HENGST® housing (Black Cap).

Vehicles Affected Include (but are not limited to):

Make	Model	Engine	Year
Chevy	Sonic-Hatch	1.4L	2013-2017
Chevy	Trax	1.4L	2015-2017
Chevy	Cruze	1.4L	2014-2015
Chevy	Cruze Limited	1.4L	2016
Buick	Encore	1.4L	2013-2017